


SEE INDIVIDUAL DWGS FOR CONNECTING VOLT, AM, AND CIR. BRKR.

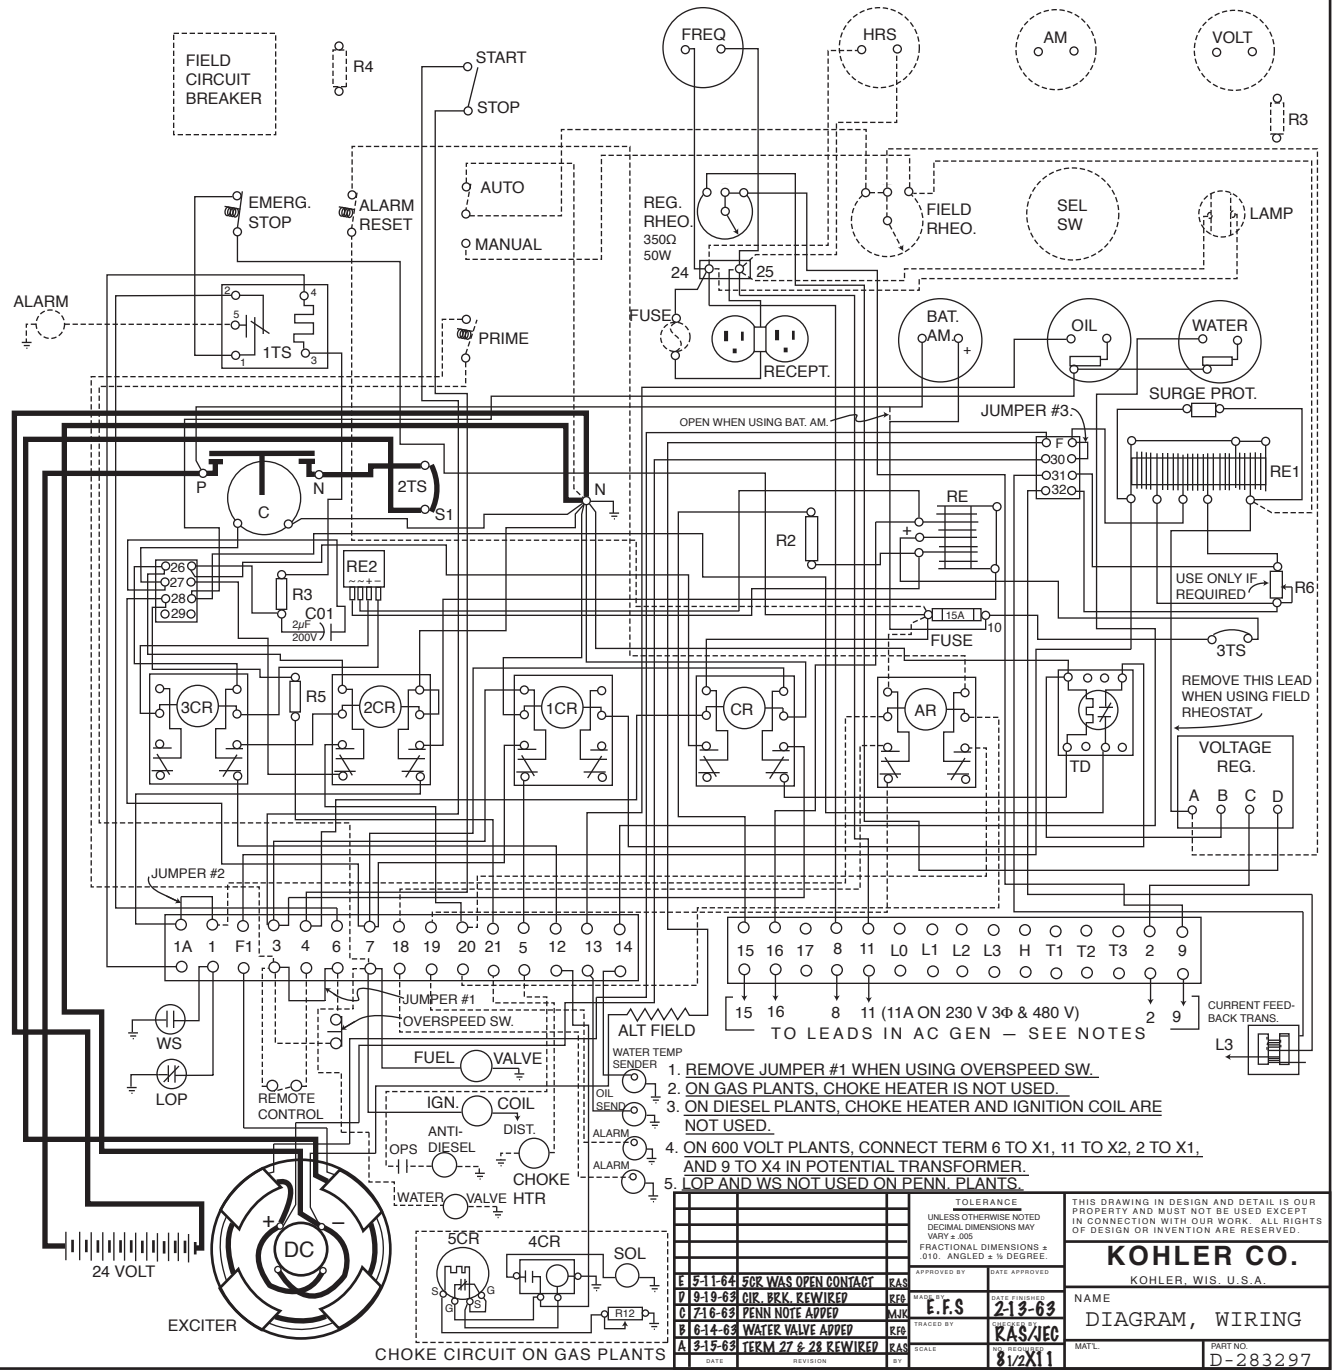

1. REMOVE JUMPER #1 WHEN USING OVERSPEED SW.
2. ON GAS PLANTS, CHOKE HEATER IS NOT USED.
3. ON DIESEL PLANTS, CHOKE HEATER AND IGNITION COIL ARE NOT USED.
4. ON 600 VOLT PLANTS, CONNECT TERM 6 TO X1, 11 TO X2, 2 TO X1, AND 9 TO X4 IN POTENTIAL TRANSFORMER.
5. LOP AND WS NOT USED ON PENN. PLANTS.

5-11-64	5CR WAS OPEN CONTACT	RAS	APPROVED BY	DATE APPROVED
7-9-63	CIR. BRK. REWIRED	E.F.S	MADE BY	DATE FINISHED
7-16-63	PENN NOTE ADDED	E.F.S	TRACED BY	DATE
8-14-63	WATER VALVE ADDED	RAS/JEC	SCALE	8/12X11
3-15-63	TERM 27 & 28 REWIRED	RAS	DATE	REVISION

THIS DRAWING IN DESIGN AND DETAIL IS OUR PROPERTY AND MUST NOT BE USED EXCEPT IN CONNECTION WITH OUR WORK. ALL RIGHTS OF DESIGN OR INVENTION ARE RESERVED.	
<b>KOHLER CO.</b>	
KOHLER, WIS. U.S.A.	
NAME	DIAGRAM, WIRING
MATL.	PART NO. D-283297